




TILT - AND - TURN MECHANISM

# GALICUBE 150



Art.1410A  
Art.1414A

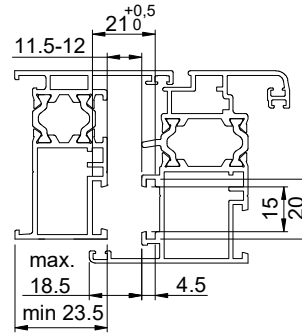

Life in evolution

ULBZ - Rev.11

EN 13126 - 8:2017 H2 150 5 1400x1550

2600	50	46	38	33	29	26	23	21	19	18	16	15	14	14
2500	50	48	40	34	30	27	24	22	20	18	17	16	15	14
2400	50	50	42	36	31	28	25	23	21	19	18	17	16	15
2300	50	50	43	37	33	29	26	24	22	20	19	17	16	15
2200	50	50	45	39	34	30	27	25	23	21	19	18	17	16
2100	50	50	48	41	36	32	29	26	24	22	20	19	18	16
2000	50	50	50	43	38	33	30	27	25	23	21	20	18	16
1900	50	50	50	45	39	35	32	29	26	24	23	21	18	16
1800	50	50	50	48	42	37	33	30	28	26	24	21	18	16
1700	50	50	50	50	44	39	35	32	29	27	24	21	18	16
1600	50	50	50	50	47	42	38	34	31	27	24	21	18	16
1500	50	50	50	50	50	44	40	36	31	27	24	21	18	16
1400	50	50	50	50	50	48	43	39	31	27	24	21	18	16
1300	50	50	50	50	50	50	46	39	31	27	24	21	18	8
1200	50	50	50	50	50	50	46	39	31	27	24	21	9	X
1100	50	50	50	50	50	50	46	39	31	27	24	11	X	X
1000	50	50	50	50	50	50	46	39	31	14	12	X	X	X
900	50	50	50	50	50	50	46	39	16	7	X	X	X	X
800	50	50	50	50	50	50	46	19	8	X	X	X	X	X
700	50	50	50	50	50	50	23	10	X	X	X	X	X	X
600	50	50	50	50	25	25	12	X	X	X	X	X	X	X
500	50	50	50	25	13	13	X	X	X	X	X	X	X	X
	400	500	600	700	800	900	1000	1100	1200	1300	1400	1500	1600	1700

mm.	Kg/mq
6	15
8	20
10	25
12	30
14	35
16	40
18	45
20	50
22	55
24	60
26	65
28	70
30	75
32	80
34	85
36	90
38	95
40	100
42	105
44	110
46	115
48	120
50	125

H ↑

→ W

Spessore vetro  
Glass thickness  
Epaisseur vitre  
Espesor vidrio  
Espessura do vidro  
Glasdicke  
Glasdikte  
Grubość szkła  
Πάχος υαλοπίνακα  
Толщина стекла  
Debljina stakla

**X** Non realizzabile  
Unrealizable  
Pas réalisable  
No se puede realizar  
Não realizável  
Unmachbar  
Niet realiseerbaar  
Niewykonalne  
Δεν παράγεται  
Не реализуемо  
Nemoguće realizovati



GÜTEZEICHEN











150 Kg


Art.1410A  
Art.1414A  
Art.1336...  
Art.1337...



Life in evolution

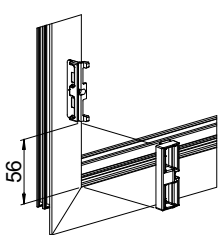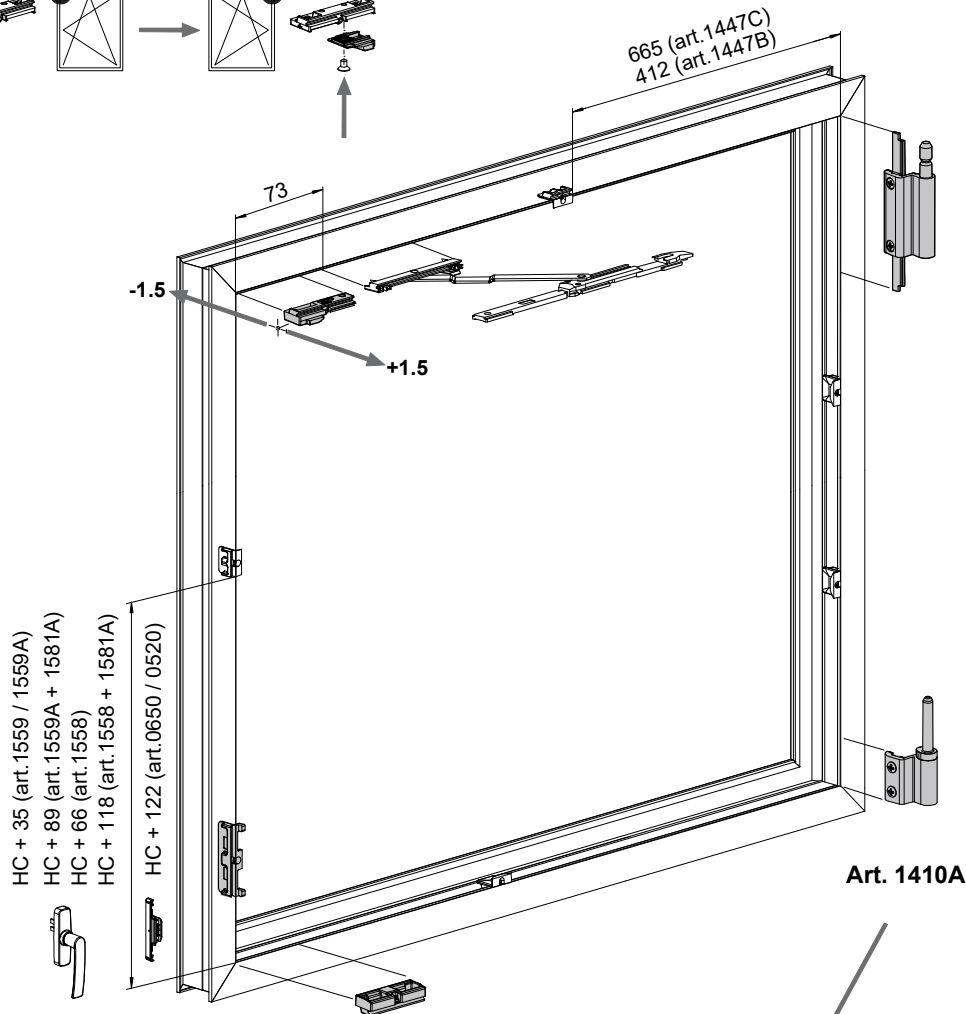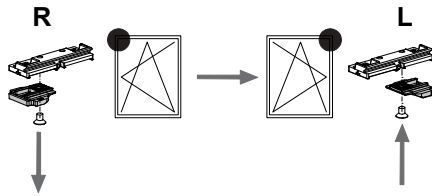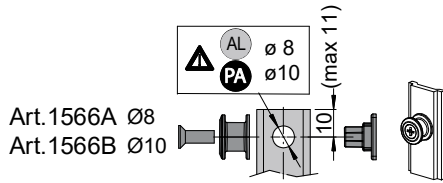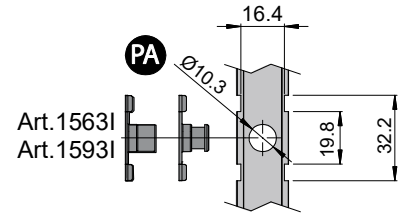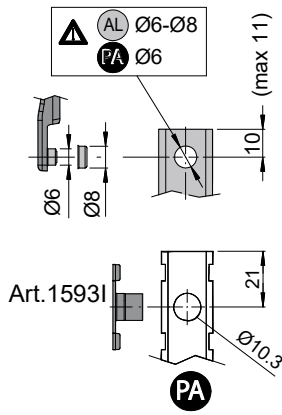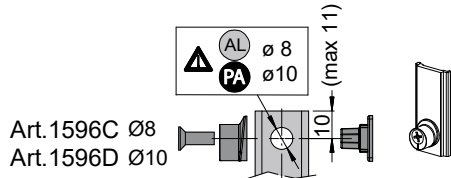

Assicurarsi che il perno e la superficie della cerniera siano ingrassate  
 Make sure that the pin and the surface of the hinge body are greased  
 Assurez-vous que l'axe et la surface de la paumelle sont graissés  
 Asegurarse que el eje y la superficie de la bisagra estén engrasados  
 Assegurar que o eixo e a superfície da dobradiça são lubrificadas  
 Versichert Ihnen, dass der Stift und die Oberfläche des Band gefettet sind  
 Verzekert U dat de pin en de oppervlakte van het scharnier ingevet zijn  
 Należy upewnić się czy sworzeń oraz powierzchnia zawiasu zostały nasmarowane  
 Βεβαιωθείτε ότι ο πείρος και η επιφάνεια του μεντεσέ είναι γρασαρισμένα  
 Убедитесь в том, что ось и посадочное место в петле смазаны  
 Proverriti da bolcna i površina šarke budu podmazane

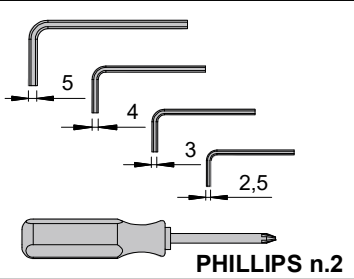



Posizionamento Cerniera  
 Hinge Positioning  
 Positionnement Paumelle  
 Colocación Bisagra  
 Positie Scharnier  
 Bandpositionierung  
 Θέση Μεντεσε  
 Местоположение  
 Postavljanje Šarke

(R) destro  
 right  
 droite  
 derecha  
 direita  
 rechts  
 δεξιά  
 петли справа  
 desno

















(L) sinistro  
 left  
 gauche  
 izquierda  
 esquerda  
 links  
 links  
 αριστερά  
 или слева  
 ili levo








Art.	L <sub>min</sub>	L <sub>max</sub>	H <sub>min</sub>	H <sub>max</sub>
1447	364	700	450	1800
1447A	402	750	500	2400
1447B	562	1200	700	2600
1447C	816	1700	700	2600
1447B+1455 +1581H	860	1200	700	2600
1447C+1455 +1581H	1114	1700	700	2600

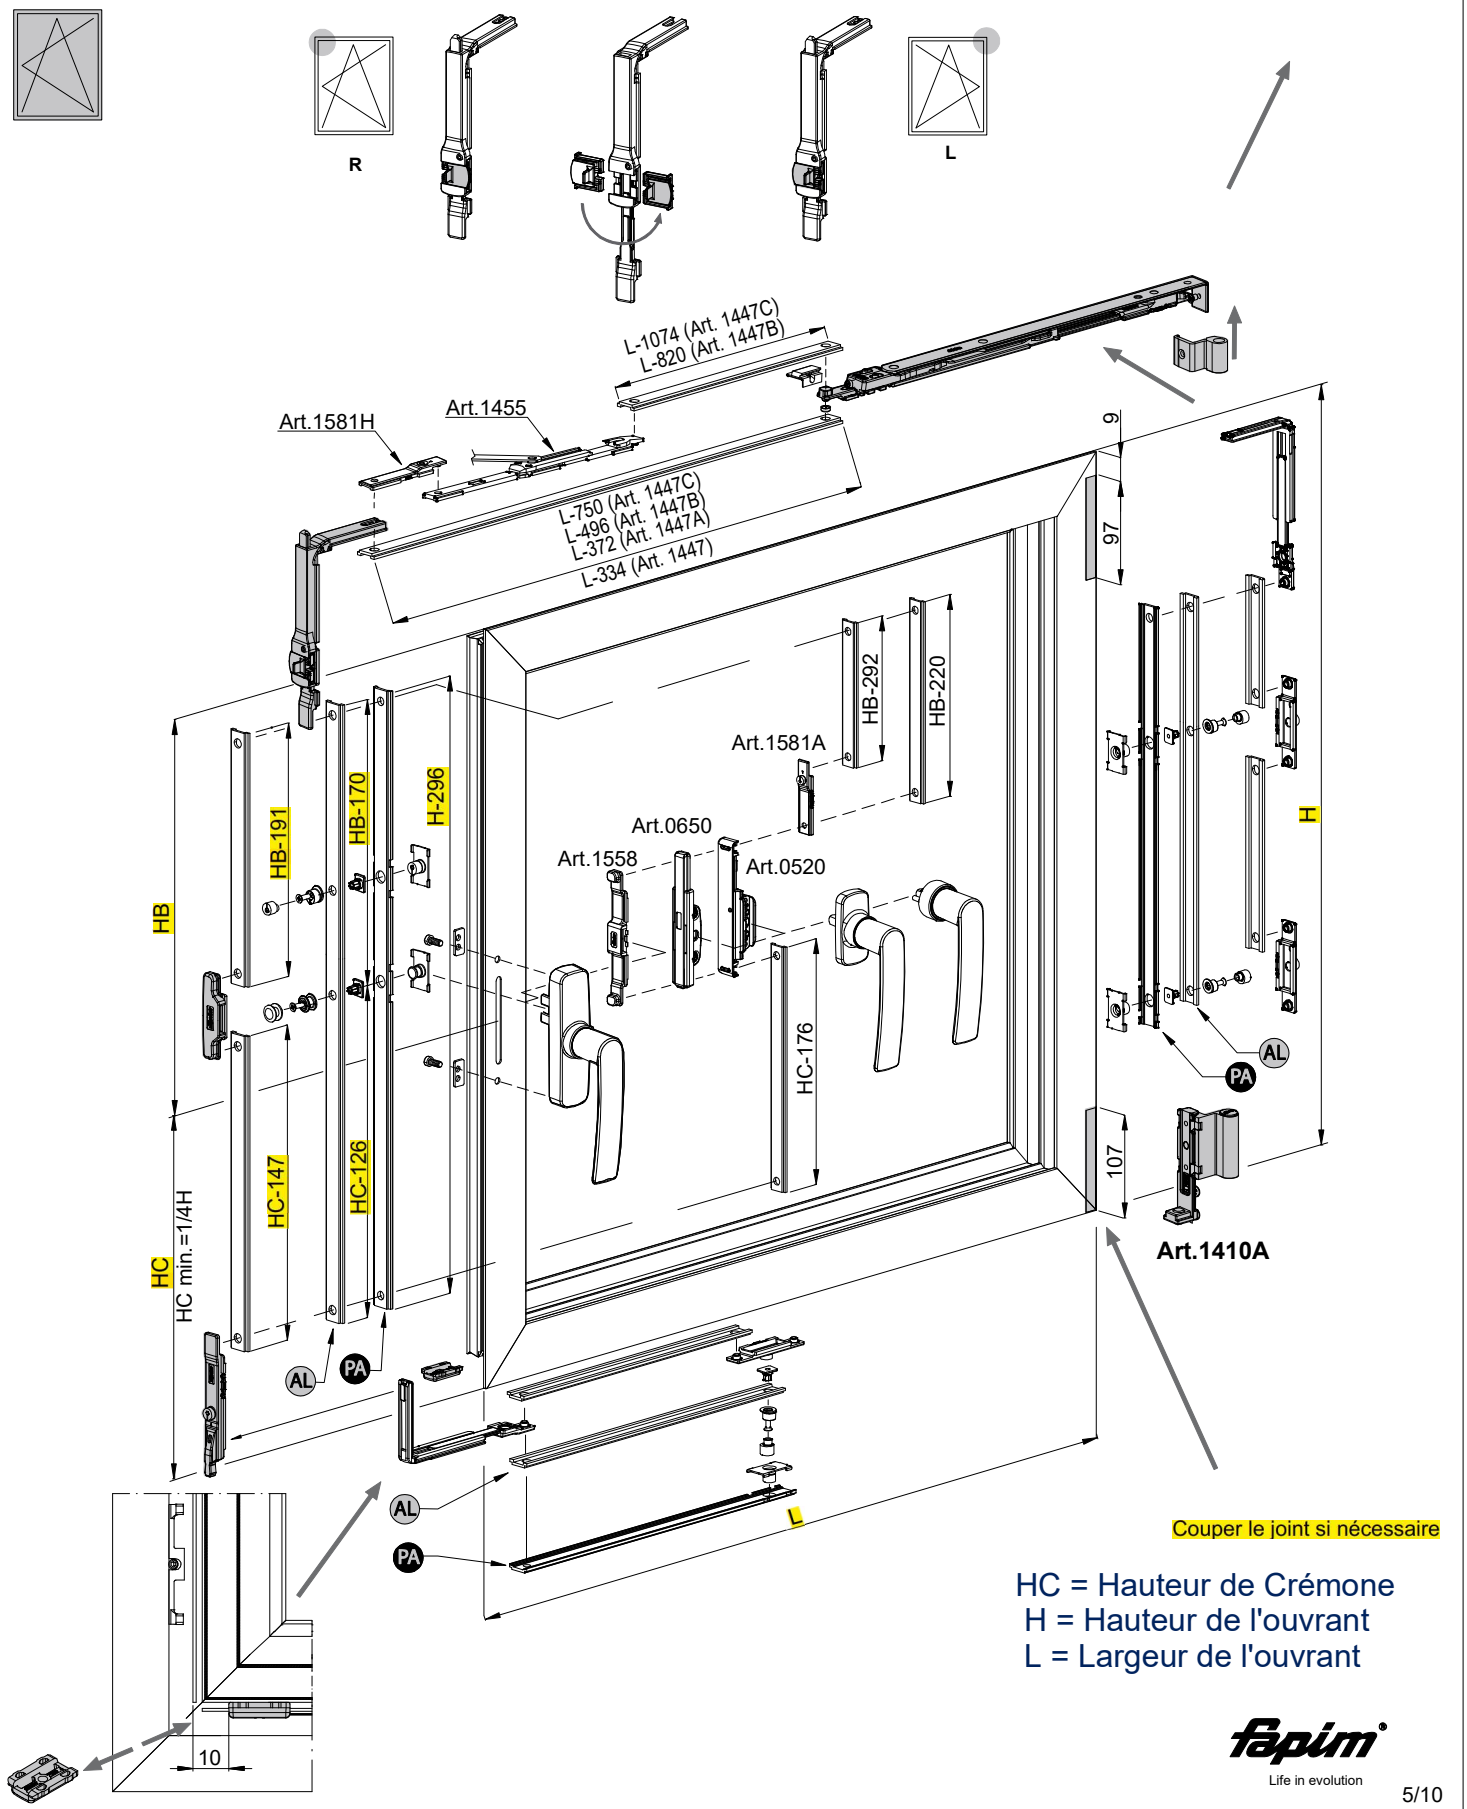

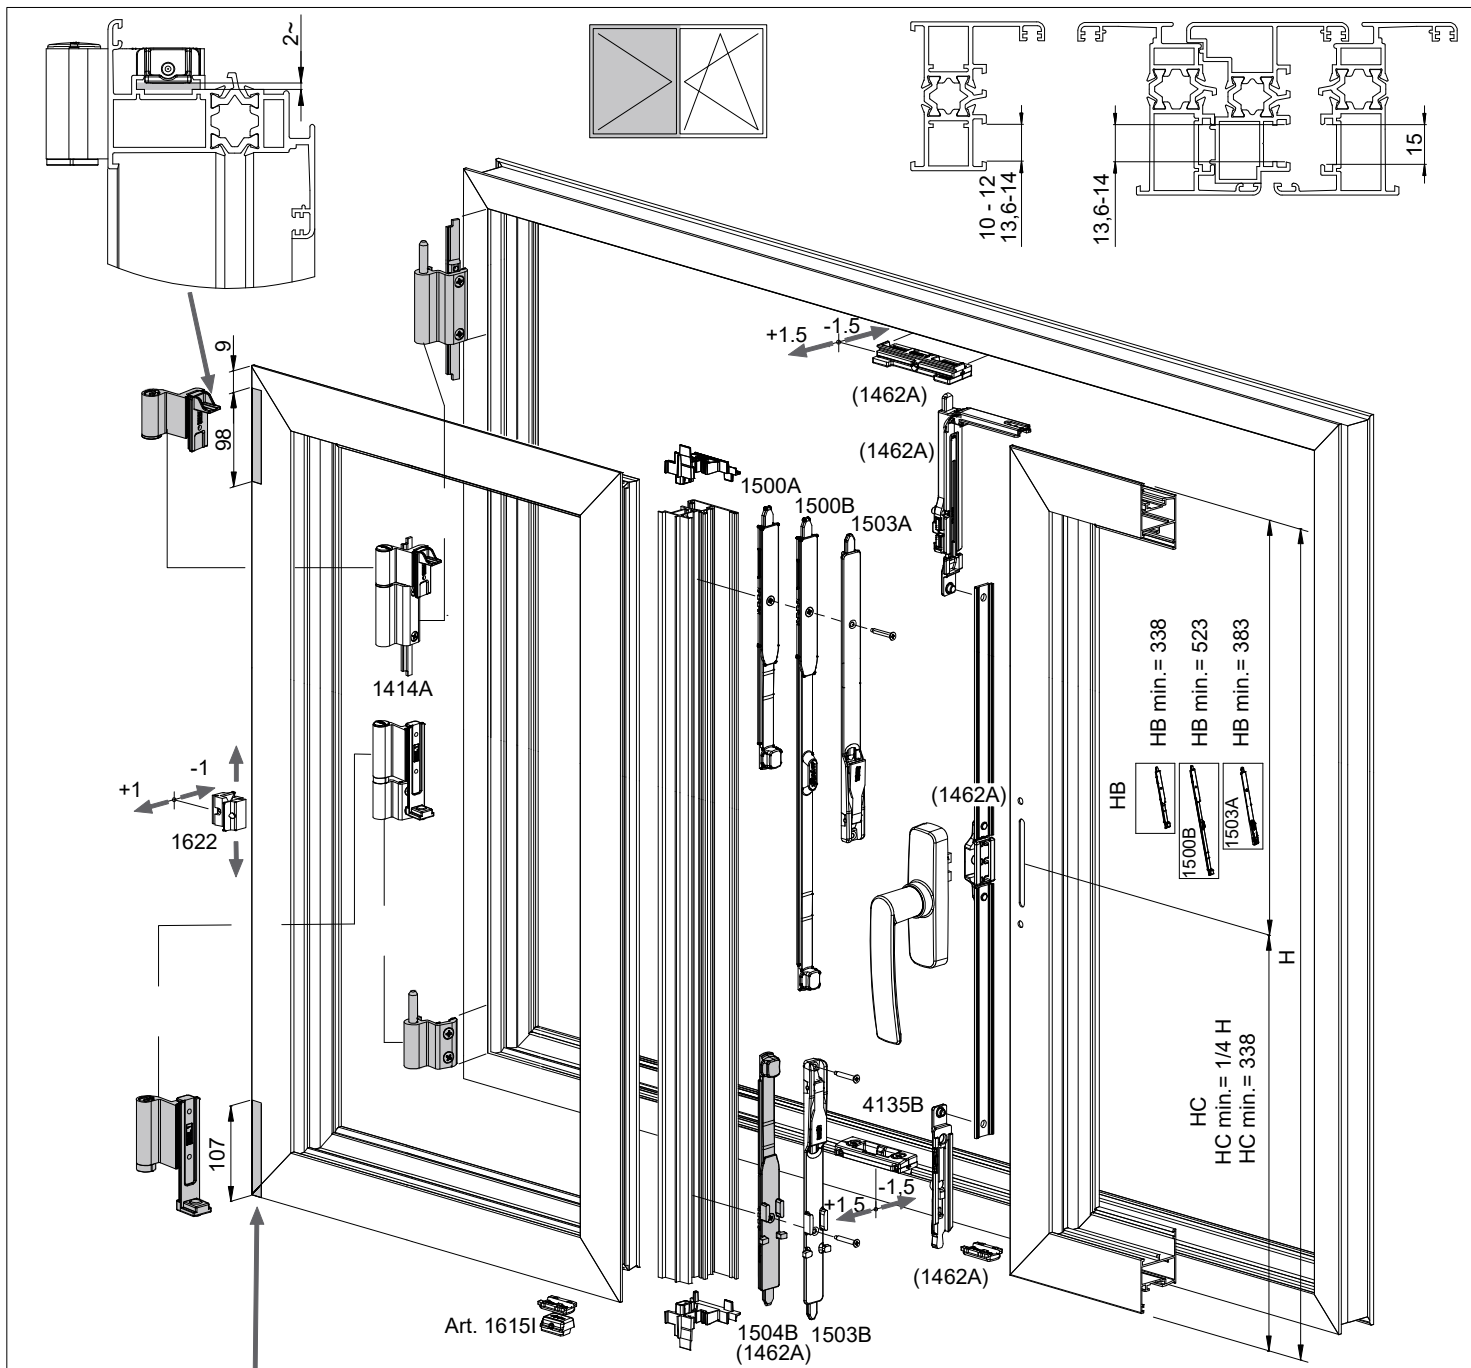







Tagliare la guarnizione se necessario  
 If required cut the joint  
 Couper le joint si nécessaire  
 Cortar la guarnición si será necesario  
 Corte a junta se necessário  
 Wenn notwendig, die Dichtung schneiden  
 Snijd de afdichting indien nodig bij  
 Podciąć uszczelkę jeśli jest to konieczne  
 Εάν είναι αναγκαίο, κόψτε την τσιμούχα  
 Подрезать уплотнение, если необходимо  
 Ukoliko je neophodno odrezati gumu dihtovanja

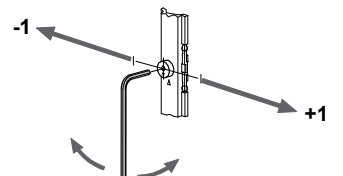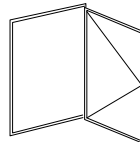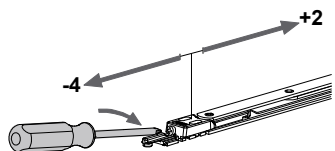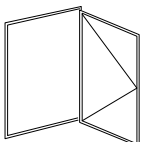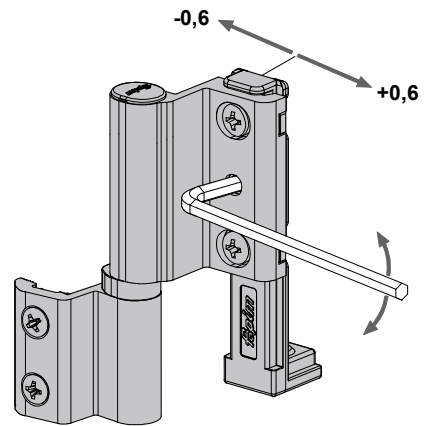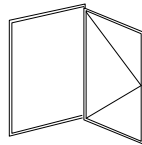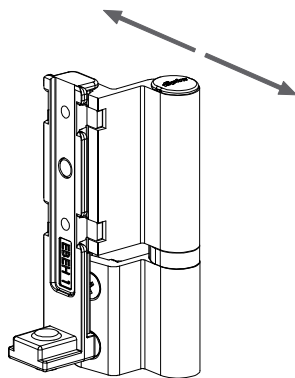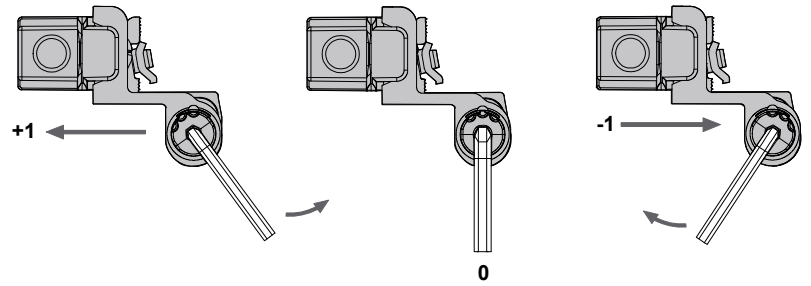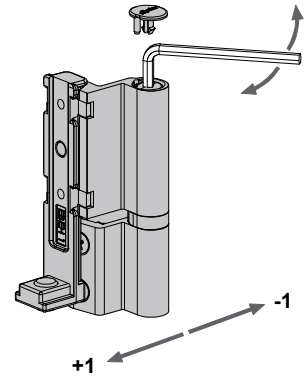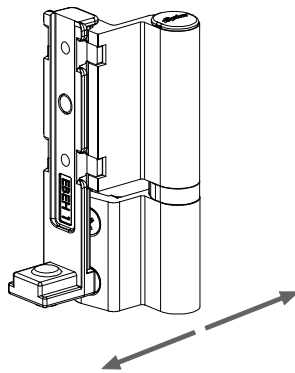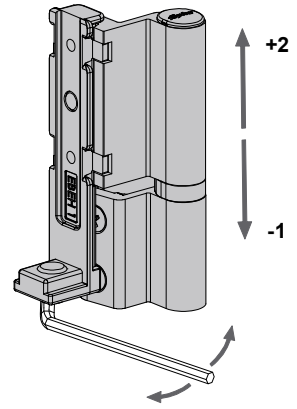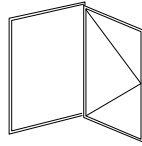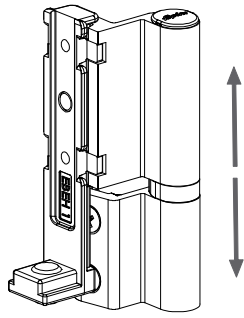

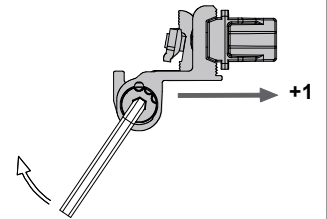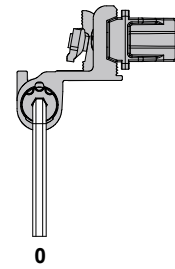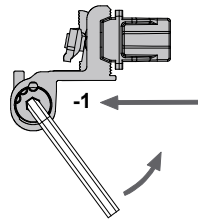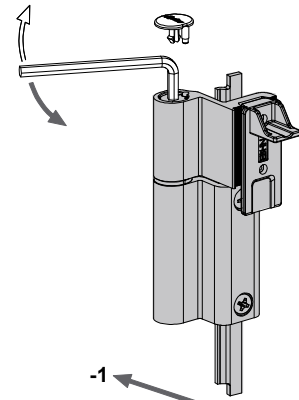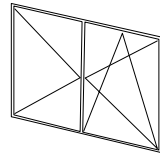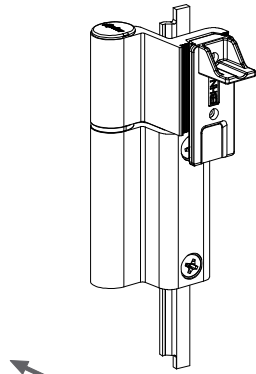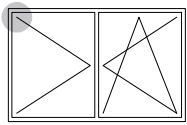





-1 → +1

0

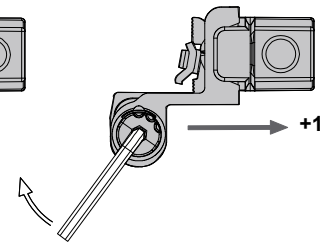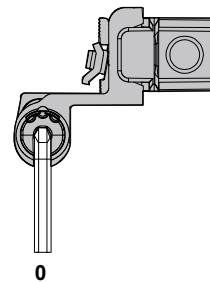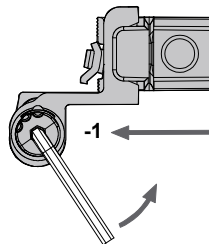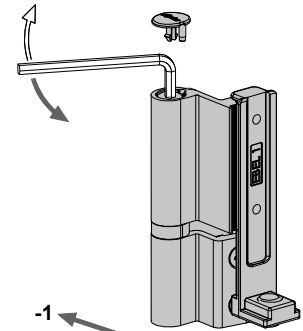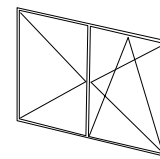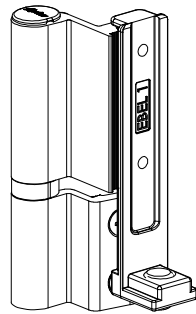

-1 → +1

0

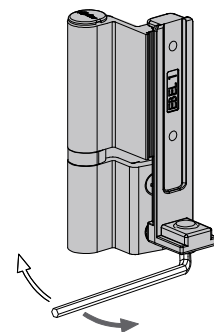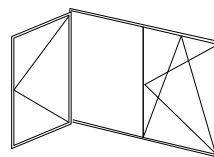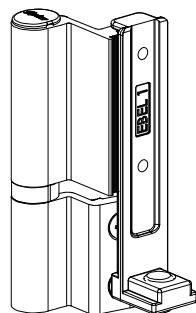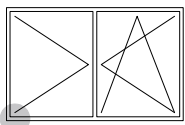

+2

-1